

Subject: Heating/Ventilation - Water Ingress

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Opel,Vauxhall	Astra-J	2010	2011	A8000001	W0LPE8EG4B8054408	All	All
Opel,Vauxhall	Astra-J	2010	2011	AG000001	W0LPE6DG1BG072974	All	All

Option	
Complaint	Water ingress in the area of instrument panel right side or blower motor no function.
Cause	Water drops down from the right front wiper linkage bracket into the heater housing.
Production	Improvements have been introduced in production as of VIN W0LPE8EG4B8054408 (plant Ellesmere Port) and VIN W0LPE6DG1BG072974 (plant Gliwice).

Remedy

In case of customer complaint ensure that Service Update "11-P-032 Astra J - HVAC Blower Motor" has been carried out.

1. Verify customer complaint

- Check instrument panel right side and right footwell for water traces
- Check function of blower motor

Important:
If water or water traces are present proceed as following described.

2. Remove blower motor and check for water traces

Note:
Replace blower motor if required.
Dry heater housing inner side.

- see working procedure "Blower Motor Replacement - Right Hand Drive", group "HVAC/Heating, Ventilation, and Air Conditioning", Service Instruction Astra-J (Document Number 92293574)

3. Remove blower motor control module and check for water traces

Note:
Replace blower motor control module if required.
Dry heater housing inner side.

- see working procedure "Blower Motor Control Module Replacement - Right Hand Drive", group "HVAC/Heating, Ventilation, and Air Conditioning", Service Instruction Astra-J (Document Number 92321809)

4. Replace passenger compartment air filter

- see working procedure "Passenger Compartment Air Filter Replacement", group "HVAC/Heating, Ventilation, and Air Conditioning", Service Instruction Astra-J (Document Number 92269791)

Spare-Parts: Part-No.: Catalogue-No.:

Filter, Interior Ventilation	13271191	18 08 246
Blower, Assy., Fan (RHD)	13276234	18 45 126
Blower, Assy., Fan (LHD)	13276230	18 45 105
Regulator, Blower	13503201	18 08 010

Labour Times:	TC:	Hours:
---------------	-----	--------

U3 276 40	Check Blower Motor and Blower Motor Control Unit, replace Passenger Compartment Air Filter	90	0.4
001	Replace Blower Motor and/or Blower Control Unit if required		0.1

The costs for this repair will be covered during warranty and policy.
For policy please refer to the Policy Guideline (WebPG/Kuugel).
The regular Warranty Procedure will apply.

Functional Group	D - Heating/Ventilation/Air conditioning
Complaint Group	10 - Leakages
Trouble Code	None

© 2010 ADAM OPEL AG. All Rights Reserved. The reproduction, distribution or modification is not permitted.