

# Field Remedy: 2642

**Subject:** Engine A16LET - Surge noise between 1500 1/min and 2000 1/min

Models:	Engines:	Option:
Astra-J 2010	A16LET	
<b>Complaint:</b>	Customer complains about surge noise during engine speed from 1500 1/min - 2000 1/min.	
<b>Cause:</b>	Turbo charger creates the surge noise.	
<b>Production:</b>	A new reinforced turbo charger hose has been introduced in November 2009.	

## Remedy:

In case of customer complaint replace the turbo charger hose:

- see Service Instruction Astra J,  
"Charge Air Cooler Inlet Air Hose Replacement"  
(Document Number: 92366968)

Note:

The new version is grey instead of black.

Spare Parts:	Part Number:	Catalog Number:
Hose, Intercooler Inlet (grey coloured)	13 344 028	8 60 220
Labour Times:	TC:	Hours:
U3 264 20      Replace Intercooler Inlet Hose	90	0.2

The costs for this repair will be covered during the normal warranty.  
The regular warranty procedure will apply.

<b>FunctionalGroup:</b>	J - Engine,L - Fuel- and Exhaust System
<b>Complaint Group:</b>	14 - Noises or Vibrations
<b>Trouble Code:</b>	

© 2010 ADAM OPEL AG. All Rights Reserved. The reproduction, distribution or modification is not permitted.