

Field Remedy: 2656

Subject: Inner Sill Trim, Clutch pedal - Distance too low

Models:

Engines:

Option:

Astra-J 2010...	All	MT (Manual Transmission)
-----------------	-----	--------------------------

Complaint:

Shoe touches inner sill trim during applying clutch.

Cause:

Deviation during mounting of inner sill trim.

Production:

Remedy:

In case of customer complaint the inner sill trim has to be removed and the carpet insulation has to be positioned correctly.


Working Procedure:

1. Measure the distance between clutch pedal and inner sill trim (Picture I, X)

Note:

X less than 125 mm is NOK


I

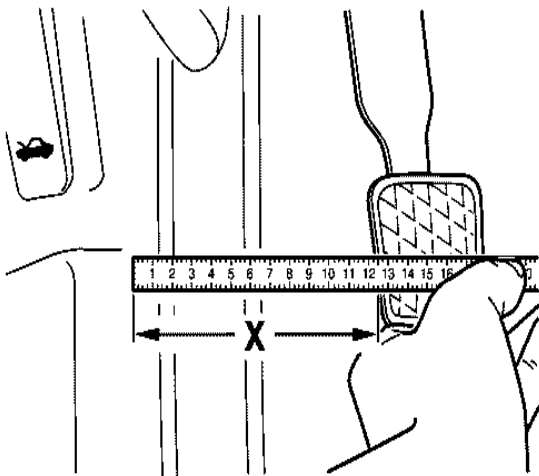

2. Remove the front and rear side door sill trim plate

- see working procedure "Front and Rear Side Door Sill Trim Plate Replacement", group "Body Hardware and Trim", Service Instruction Astra-J.
(Document Number 92288837)

3. The insulation (Picture II, 1) of the front floor carpet has to be positioned correctly behind the wiring harness connector (2).

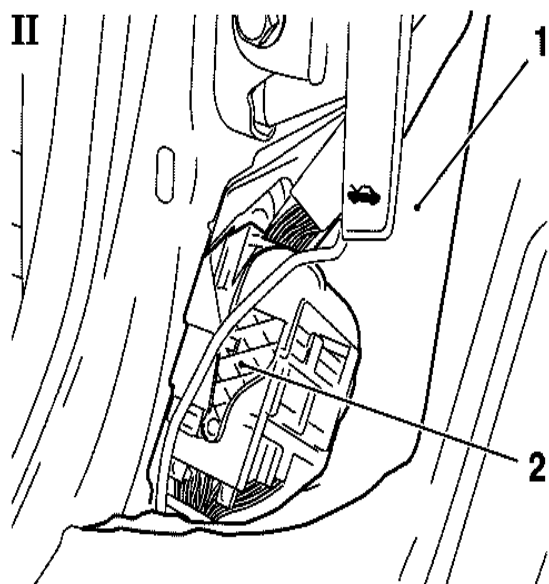


4. Install the front and rear side door sill trim plate

- see working procedure "Front and Rear Side Door Sill Trim Plate Replacement", group "Body Hardware and Trim", Service Instruction Astra-J. (Document Number 92288837)

Note:

Install from front to rear.

Make sure that the guidance pin (Picture III, 1) is correctly installed to the positioning hole (2).

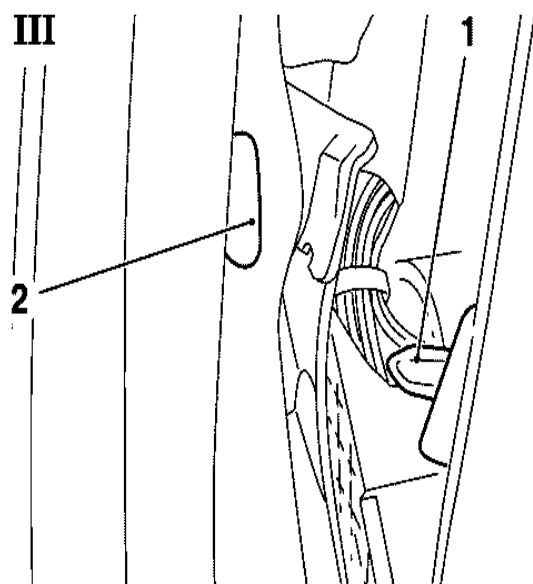

Labour Times:

TC:

Hours:

U3 265 60 Correct Installation
of the Inner Sill Trim

90

0,3

The costs for this repair will be covered during the normal warranty.
The regular Warranty Procedure will apply.

FunctionalGroup:

C - Equipment/Windows

Complaint Group:

11 - Loose or Comes off

Trouble Code:

None

© 2010 ADAM OPEL AG. All Rights Reserved. The reproduction, distribution or modification is not permitted.