

Field Remedy: 2700

Subject:

Clutch Pedal - Noisy

Models:
Engines:
Option:

Astra-J 2010

All

MT

Complaint:

Squeak noise occurs during clutch pedal applying.

Cause:

Deviation in grease apply process at supplier.

Production:


Remedy:

In case of customer complaint, grease clutch pedal spring.

2 different designs of clutch pedal springs exist:

Version I: Clutch return spring (Pic I, 1)


Version II: Over Center Spring (Pic I, 2)

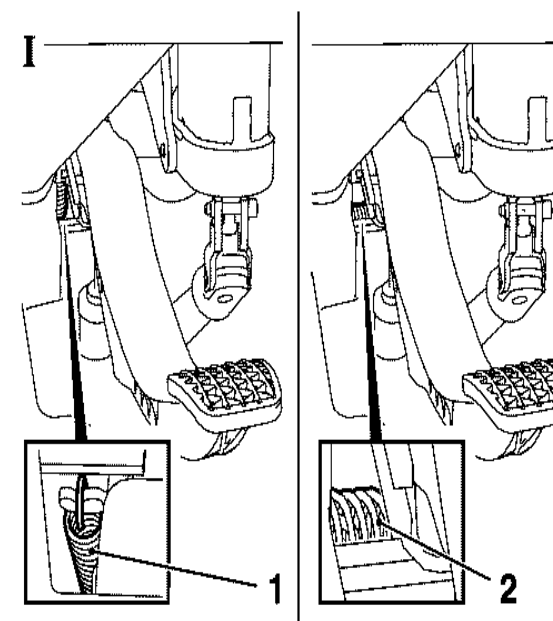

Tip: To get access to the clutch pedal springs for the greasing operation we recommend to use an approximately 1cm wide and 30cm long paint-brush. Alternatively a grease spray with a long capillary tube can be used to apply the grease to the spring.

Important: Do not use oil spray! Oil spray solves the noise issue only for a while and removes the originally applied grease. The squeak noise will return after short time.

Access to the upper spring fixing point (important to be greased) of spring version I, is possible through the gap between the steering column trim and lower instrument panel trim. Lower part of the spring can be reached from the legroom.

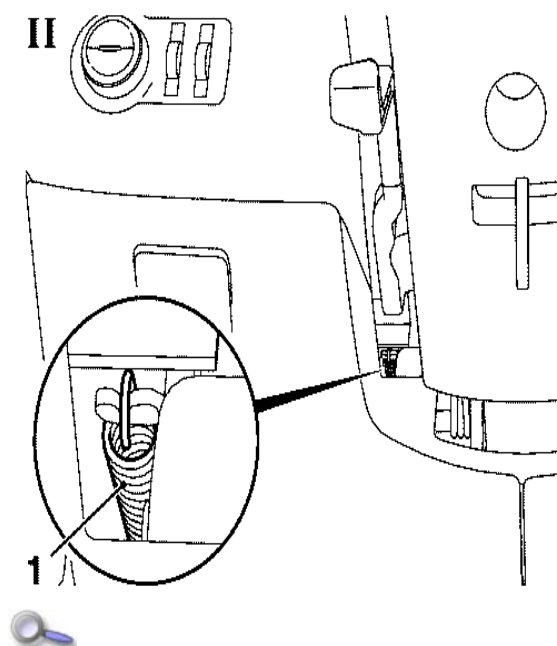

Access to spring version II is also possible through the legroom.

1. Remove cover of fuse box instrument panel
2. Hang out fuse box and lay aside
(To achieve space for use of hand lamp)
3. Apply grease in idle and actuated position between the coils
4. Apply clutch several times to spread the grease

Note: Repeat operation until squeak noise disappears.

5. Hang in fuse box and install cover

Labour Times:	TC:	Hours:
U327000 Grease clutch pedal return spring	90	0.2

The costs for this repair will be covered during the normal warranty.
The regular warranty procedure will apply.

FunctionalGroup:

Complaint Group:

Trouble Code:

K - Clutch/Transmission
02 - Chafing,14 - Noises or Vibrations

© 2010 ADAM OPEL AG. All Rights Reserved. The reproduction, distribution or modification is not permitted.