

Technical Service Bulletin

2735

Subject: Radio CD400, CDC400 - USB Connector no Function

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Opel, Vauxhall	Astra-J	2010	2010			All	
Opel, Vauxhall	Insignia	2009	2010			All	

Option

USB Connector (RPO Code KTA).

Complaint

USB stick and auxiliary players not supported via USB port. After battery reset some are functional again.

Cause

Hardware/Software issue.

Production

Solved with NEW hardware/software as of MY 2011.

Remedy

In case of customer complaint replace the multi media interface module.

Working Procedure:**Astra-J:**


1. Replace multi media interface module
 - see working procedure "Multimedia Player Interface Module Replacement", group "Driver Information and Entertainment/Cellular, Entertainment, and Navigation", Service Instruction Astra-J. (Document Number 92283241)

Note:

Programming and configuration of the multi media interface module is NOT required.

Insignia:

1. Disconnect battery
2. Remove instrument panel compartment
 - see working procedure "Instrument Panel Compartment Replacement", group "Body Hardware and Trim/Instrument Panel and Console Trim", Service Instruction Insignia. (Document Number 92141319)
3. Replace multi media interface module (Picture I, 1)
 - Disconnect 2 wiring harness electrical connectors
 - Detach multi media interface module (arrow) and pull out of bracket

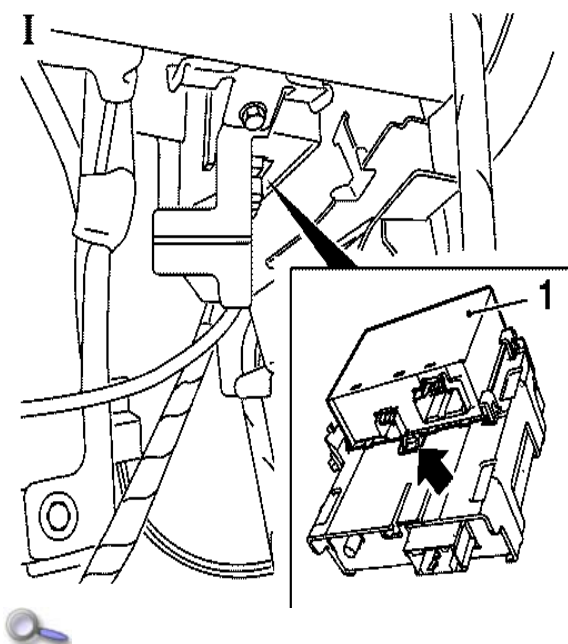

4. Install instrument panel compartment

- see working procedure
 "Instrument Panel Compartment Replacement", group
 "Body Hardware and Trim/Instrument Panel and Console Trim",
 Service Instruction Insignia.
 (Document Number 92141319)

5. Connect battery

6. Program volatile memories

Spare-Parts:	Part-No.:	Catalogue-No.:
Module, Portable Device Interface	22739796	17 88 271
Labour Times:	TC:	Hours:
U3 273 50 Multimedia Player Interface Module Replacement	90	0.3

The costs for this repair will be covered during warranty and policy.
 For policy please refer to the Policy Guideline (WebPG/Kuugel).
 The regular Warranty Procedure will apply.

FunctionalGroup

N - Electrical Equipment

Complaint Group

04 - Electrical failures

Trouble Code

None

© 2010 ADAM OPEL AG. All Rights Reserved. The reproduction, distribution or modification is not permitted.